

Airframe Log

Berkshire Aviation Enterprises Inc.

PO Box 179, 70 Egremont Plain Rd, Great Barrington, MA 01230-0179 (413) 528-2030

N6077A

Cessna 172

S/N: 28677

8/5/24

Tach: 3087

AD 11-10-09 Seat Tracks C/W by insp. AD 76-07-12 R1 Bendix ign sw C/W by ops ck. Replaced induction air filter with BA-6108. Replaced ELT battery with BP1010. Next replacement due Aug 26. Ckd ELT per FAR 91.207(D). Replaced landing light with Whelen LED p/n 01-0771833-10 s/n 832316. *8/5/24 [Signature] for BPGR558C*

I certify that this aircraft has been inspected in accordance with a Annual inspection and found to be airworthy.

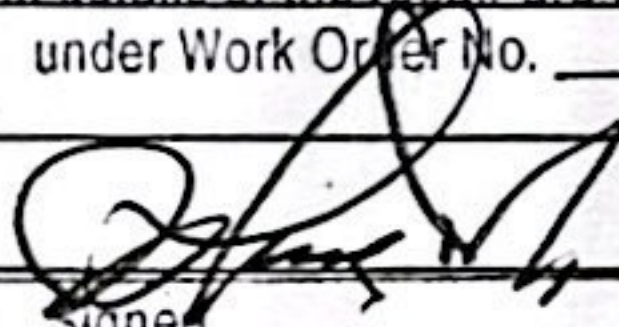
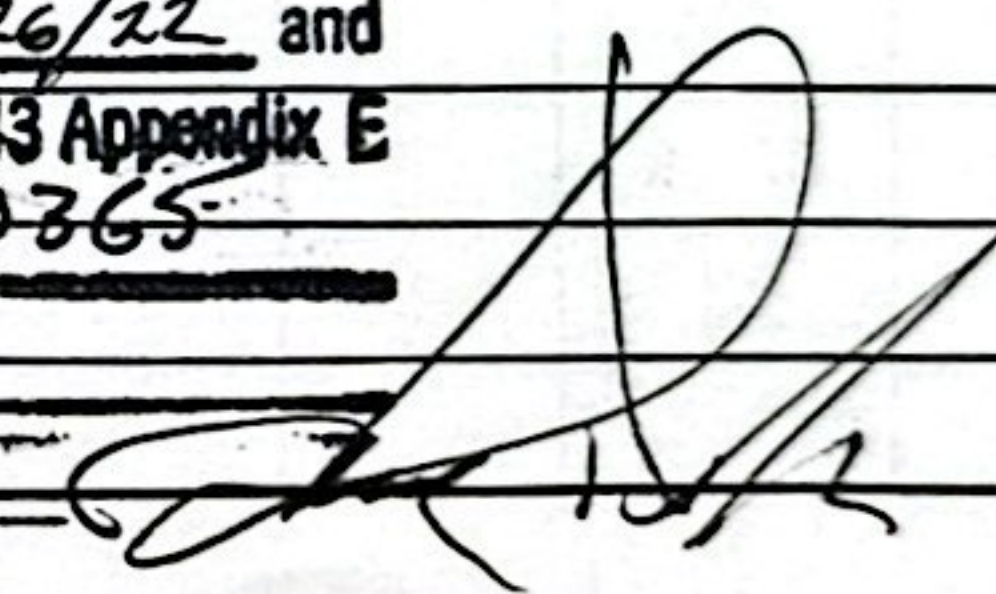
Berkshire Aviation Ent. LLC.

FAA approved repair station No. BPGR558C

Repair order on file No. 8908

[Signature]
Signed

8/5/24
Date

DATE 19__	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
7/18/22	3073			Installed UAvionix tail beacon P/n UAV-1002183-001 S/n 2020783. ADS-B tail beacon installed in accordance with Installation guide # UAV-1002514-001. See 337 this date. 7/18/22 (Passwork: India Apron) Copy sent for B7GILS58C The aircraft, aircraft engine, airframe, propeller, or appliance identified above was repaired and inspected in accordance with current Regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. <u>8321</u>  7/18/22 Signed Date Berkshire Aviation Ent. LLC No. BPGR558C
8/26/22	3075			A T C transponder tests and inspections required by F A R 91.413 (a). (b) were performed this date <u>8/26/22</u> and found to comply with Part 43 Appendix E No. 1 <u>AT150/10365</u> No. 2 _____ W.O. <u>8386</u> signed 

REPAIRS AND ALTERATION
ING AND CERTIFICATE NUMB
GES FOR OTHER SPECIFIC EN

QA-10

47150 / 10365

1/3 Signed

at Great Barrington
Kevin flew to PSF.

Inspected in accordance
and found to be airworthy.

Berkshire Aviation Ent. LLC.

FAA approved repair station No. BPGR558C

Repair order on file No.

Signed

Date _____

DATE 20 SEP	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
-------------------	---------------------------	------------------	-----------------------------	---

Berkshire Aviation Enterprises Inc.

PO Box 179, 70 Egremont Plain Rd, Great Barrington, MA 01230-0179 (413) 528-2030

N6077A

172

S/N:28677

7/09/2019

TACH: 3049

AD 11-10-09 Seat tracks c/w by insp. AD 76-07-12 R1 bendix ign. sw. c/w by ops ck only. Replaced induction air filter BA6108. Replaced taxi light bulb 4509. Ck Elt per 91.207(D). 7/09/2019

Officer Dick for BPGR558C

I certify that this aircraft has been inspected in accordance with a ~~visual~~ inspection and found to be airworthy

Berkshire Aviation Ent. Inc.

FAA approved repair station No. BPGR558C

Repair order on file No. 1515

[Signature]
Signed _____ Date 7/9/19

				FLIGHT TOTAL		
5-2-20	3051.4	.5	to Columbia Co.	Kevin	0:30	0:30
5-2-20	3051.8	.4	to PSF.	Kevin	0:30	1:00
5-8-20	3052.4	.6	PSF, 7 landings (6 touch n go, 1 full stop)	Kevin	1:00	2:00
5-14-20	3053.1	.7	to North Adams & back. 2 full stop L at PSF.	Kevin	1:00	3:00

DATE 20	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
10-18-17	3025.4	.3		to PSF.
10-22-17	3026.1	.7		to Sky Acres.
10-22-17	3026.7	.6		to PSF.
4-14-18	3027.3	.6		Actual time: 55 minutes - 4 TO's & L's to full stop, runway 32.
4-23-18	3027.6	.3		Actual time: 22 minutes - to Great Barrington, runway 29.
6/20/18	3027.8	.2	3027.8	AD 11-10-09 seat tracks clw by insp. only.
				AD 76-07-12 Bendix ign. sw. clw by ops CK only.
				Replaced induction air filter BA6108 w/ new. Replaced
				Elt battery w/ new BP1010. Next due July 2020. CK EIT
				per 91.207(D). 6/20/18 <i>[Signature]</i> P. 31GRS58C
I certify that this aircraft has been inspected in accordance with a <u>Annual</u> inspection and found to be airworthy <u>Berkshire Aviation Ent. Inc.</u> FAA approved repair station No. <u>BPR558C</u> Repair order on file No. <u>7265</u>				A T C transponder tests and inspections required by F A R 91.413 (a), (b) were performed this date <u>6/20/18</u> and found to comply with Part 43 Appendix F
<i>[Signature]</i>			<u>6/20/18</u>	No. 1 <u>AT150 / 10365</u>
Signed			Date	No. 2 <u> </u>
				W.O. <u>7265</u> Signed <i>[Signature]</i>

DATE 20____	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
11-28-16	3000.5	.6		PSF local flight, 3 takeoffs & 3 landings.
2-20-17	3001.1	.6		PSF local flight, 3 takeoffs & 3 landings.
2-24-17	3001.3	.2		PSF local flight, 1 takeoff & 1 landing.
4-23-17	3001.7	.4		To Columbia Co.
4-23-17	3002.0	.3		to PSF.
5-23-17	3002.3	.3		To Great Barrington.
5/31/17	3002		3002	AD 11-10-09 Seat tracks c/w by insp only. AD 76-07-12 Bendix ign. sw. c/w by cps ck. Replaced induction air filter, CK EIT per FAR 91.207(D). Replace A/C Battery with new Gill 7025-20. s/n G02956450. Replaced all brake pads, 4 each. OGG-10500. 5/31/17 <i>[Signature]</i> BPG-R558C - I certify that this aircraft has been inspected in accordance with a Annual inspection and found to be airworthy Berkshire Aviation Ent. Inc. FAA approved repair station No. BPGR558C Repair order on file No. ... <u>7014</u> ... <i>[Signature]</i> 5/31/17

BERKSHIRE AVIATION ENT. INC.
 GREAT BARRINGTON AIRPORT
 GREAT BARRINGTON, MASS. 01230
 FAA APPROVED REPAIR STATION
 No. BPGR558C