

Prop Log

Berkshire Aviation Enterprises Inc.

PO Box 179, 70 Egremont Plain Rd, Great Barrington, MA 01230-0179 (413) 528-2030

N6077A

Cessna 172

S/N: 28677

8/5/24

Tach: 3087

Dressed blades. Inspected spinner. Painted face.

8/5/24 J.P. for BPGR558C

I certify that this aircraft has been inspected in accordance with a Annual inspection and found to be airworthy.

Berkshire Aviation Ent. LLC.

FAA approved repair station No. BPGR558C

Repair order on file No. 8908


Signed

8/5/24
Date

Engine Log

Berkshire Aviation Enterprises Inc.

PO Box 179, 70 Egremont Plain Rd, Great Barrington, MA 01230-0179 (413) 528-2030

N6077A

Cessna 172

S/N: 28677

8/5/24

Tach: 3087

Changed oil with 8 Qts of Shell 15-50. Cleaned and inspected oil screen. Replaced induction air filter with BA-6108. Drained carb. Clean and gapped plugs. Comp ck 1)75 2)72 3)75 4)77 5)65 6)75/80. Cleaned oil sump screen. Test run engine. Ops cks okay. 8/5/24 J.P. for BPGR558C

I certify that this aircraft has been inspected in accordance with a Annual inspection and found to be airworthy.

Berkshire Aviation Ent. LLC.

FAA approved repair station No. BPGR558C

Repair order on file No. 8908


Signed

8/5/24
Date

19_

**TOTAL
TIME IN
SERVICE**

REFERENCE OF MAJOR REPAIRS AND MAJOR ALTERATIONS TO
FAA FORM ACA-337 BY DATE, OR TO THE WORK ORDER BY NUMBER AND THE APPROVING AGENCY.

7/30/23	3080
---------	------

Jack	3083
------	------

8m04	725'
------	------

Changed oil w/ 8 qts Shell 15-50, clean oil screen,
cleaned oil sump screen, ck mags, drained carb,
clean & gap plugs, Comp ck 1) 75 2) 70 3) 75 4) 73
5) 70 6) 76/80. Test ran engine. ops ck OK.
Inspected spinner & prop blades, dressed blades & painted
face. 7/30/23 ~~Officer~~ Dale P. BGR558C

I certify that this aircraft has been inspected in accordance with a Annual inspection and found to be airworthy.

Berkshire Aviation Ent. LLC.

FAA approved repair station No. BPGP558C

Repair order on file No. 8674

Signed

Date _____

7/30/23

DATE

19__

TOTAL
TIME IN
SERVICEREFERENCE OF MAJOR REPAIRS AND MAJOR ALTERATIONS TO
FAA FORM ACA-337 BY DATE, OR TO THE WORK ORDER BY NUMBER AND THE APPROVING AGENCY.

7/6/22

3072

Tach 3072

changed oil w/ 8 qts Shell 15-50, cleaned oil screen, ck mags,
drained carb, clean & gap plugs, Comp ck 1) 74 2) 71 3) 74 4) 74
5) 70 6) 76/80. Test run engine. ops ck ok. 7/6/22
Offing Dodge for BPGR558C.

BERKSHIRE AVIATION ENT. LLC.
EAT BARRINGTON AIRPORT
AT BARRINGTON, MASS. 01230
APPROVED REPAIR STATION
No. BPGR558C

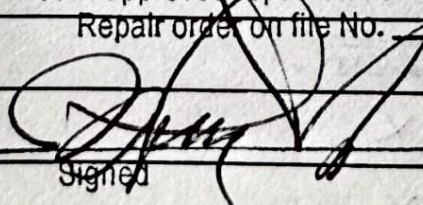
I certify that this aircraft has been inspected in accordance
with a Annual inspection and found to be airworthy.
Berkshire Aviation Ent. LLC.

FAA approved repair station No. BPGR558C
Repair order on file No. 8310

Signed

Date

7/6/22

DATE 26 6/30/21	RECORDING TACH TIME 3065	TODAYS FLIGHT	TOTAL TIME IN SERVICE 3065	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
				SMOH 707 Changed oil w/ 8 qts Shell 15-50, cleaned oil screen, ck magps, drained carbs, clean & gap plugs, Replaced #5 top plug REM 4108. Comp ck 1) 72 2) 70 3) 72 4) 75 5) 72 6) 78. Removed cyl #2 due to low comp. Lapped intake valve & reinstalled. original comp is 35/70 Dressed prop, painted face, Inspected spinner. Test ran engine. ops ck ok. 6/30/21 Off for BPGR558C.
				I certify that this aircraft has been inspected in accordance with a <u>Annual</u> inspection and found to be airworthy. Berkshire Aviation Ent. LLC. FAA approved repair station No. BPGR558C Repair order on file No. <u>8025</u>  Signed 6/30/21 Date

DATE 20 ●	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
8/14/20	3059		3059	SMOH 701 Changed oil w/ 8 qts Shell 15-50, cleaned oil screen C.K. mags, drained carb, clean & gap plugs comp C.K. 1) 72 2) 56 3) 76 4) 73 5) 63 6) 75. Inspected spinner, dressed blades & painted face. Test run engine, ops ok ok. 8/14/20 <i>[Signature]</i> for BPGR558C
				I certify, this aircraft has been inspected in accordance with a <u>Annual</u> inspection and found to be airworthy. Berkshire Aviation Ent. LLC. FAA approved repair station No. BPGR558C Repair order on file No. <u>7813</u> <i>[Signature]</i> Signed <u>8/14/20</u> Date
8/14/20	3059.6	—		at Great Barrington.
8/17/20	3060.0	.4		Kevin flew to PSF.

DATE 20 9	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
-----------------	---------------------------	------------------	-----------------------------	---

Berkshire Aviation Enterprises Inc.

PO Box 179, 70 Egremont Plain Rd, Great Barrington, MA 01230-0179 (413) 528-2030

N6077A

172

S/N:28677

7/09/2019

TACH:3049

SMOH:691

ETT:3049

AD98-01-06 Two Piece Venturi c/w by insp. Changed oil w/8qts shell 15-50.Clean oil sump screen, ck mags, clean and gapped plugs, drained carb. Comp ck 1)72 2)58 3)74 4)76 5)70 6)78 7)80 Test ran engine. Ops ck gd. Dressed prop. 7/09/2019

[Signature] per BR06558C

I certify that this aircraft has been inspected in accordance with a Annual inspection and found to be airworthy

Berkshire Aviation Ent. Inc.

FAA approved repair station No. BPGR558C

Repair order on file No.7525....

Signed _____

7/9/19

Signed

Date _____

						FLIGHT	TOTAL
5-2-20	3051.4	.5		to Columbia Co.	Kevin	0:30	0:30
5-2-20	3051.8	.4		to PSF.	Kevin	0:30	1:00
5-8-20	3052.4	.6		PSF, 7 landings (6 touch n go, 1 full stop.)	Kevin	1:00	2:00
5-14-20	3053.1	.7		to North Adams & back. 2 full stop L at PSF	Kevin	1:00	3:00

DATE 20 ●	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
10-18-17	3025.4	.3		to PSF.
10-22-17	3026.1	.7		to Sky Acres.
10-22-17	3026.7	.6		to PSF.
4-14-18	3027.3	.6		Actual time: 55 minutes - 4 TO's & L's to full stop, runway 32.
4-23-18	3027.6	.3		Actual time: 22 minutes - to Great Barrington, runway 29.
6/20/18	3027		3027	Changed oil, clean oil screen, ck mags, clean &
		SMOH	669	gap plugs, drained carb, comp ck 1) 72
				2) 58 3) 73 4) 75 5) 61 6) 74. Test ran
				engine. ops ck OK. 6/20/18
				<i>[Signature]</i> for BPG558C
				I certify that this aircraft has been inspected in accordance
				with a <u>Annual</u> ... inspection and found to be airworthy
				Berkshire Aviation Ent. Inc.
				FAA approved repair station No. BPG558C
				Repair order on file No. ...7263...
				<i>[Signature]</i> 6/20/18
				Signed Date

DATE 20 —	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
11-28-16	3000.5	.6		PSF local flight, 3 takeoffs & 3 landing.
2-20-17	3001.1	.6		PSF local flight, 3 takeoffs & 3 landing.
2-24-17	3001.3	.2		PSF local flight, 1 takeoff & 1 landing.
4-23-17	3001.7	.4		to Columbia Co.
4-23-17	3002.0	.3		to PSF.
5-23-17	3002.3	.3		to Great Barrington.
5/31/17	3002		3002	A198-01-06 Two piece venturi due 3040. Changed oil, clean oil screen, ck mags, Clean & gap plugs, drain carb, comp ck 1)70 2)65 3)74 4)75 5)72 6)73 Test run engine. ops OK OK. 5/31/17 <i>[Signature]</i> P- SMOH 644 BGR558C.
BERKSHIRE AVIATION ENT. INC. GREAT BARRINGTON AIRPORT GREAT BARRINGTON, MASS. 01230 FAA APPROVED REPAIR STATION No. BGR558C				I certify that this aircraft has been inspected in accordance with a <i>Annual</i> inspection and found to be airworthy Berkshire Aviation Ent. Inc. FAA approved repair station No. BGR558C Repair order on file No. <i>7014</i>

Signed

Date

DATE 20 ●	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
5/28/15	2948		2948	SIMOH 590 changed oil w/ 8 qts Shell 15-50, cleaned oil screen, ck mags, drained carb, cleaned 8 geyd plugs, Replace one plug REM40E due to high resistance. Comp ck 1)70 2)65 3)75 4)73 5)75 6)74. Test run engine. ops ok OK. 5/28/15 <i>[Signature]</i> Delp Sr BPGR558C.
				I certify that this aircraft has been inspected in accordance with a <u>Annual</u> inspection and found to be airworthy
				Berkshire Aviation Ent. Inc.
				FAA approved repair station No. BPGR558C
				Repair order on file No. <u>6656</u>
				<i>[Signature]</i> 5/28/15 Date
7-17-15	2949.9	.3		PSI - IBI. To EAA.
7-17-15	2952.3	2.4		IBI - G VQ. To EAA.
7-17-15	2954.7	2.4		G VQ - CGF. To EAA.
7-18-15	2958.0	3.3		CGF - VPZ. To EAA.
7-18-15	2959.3	1.3		VPZ - MKE. To EAA.
7-18-15	2960.3	1.0		MKE - OSH. To EAA.

BERKSHIRE AVIATION ENT. INC.
GREAT BARRINGTON AIRPORT
GREAT BARRINGTON, MASS. 01230
FAA APPROVED REPAIR STATION
No. BPGR558C

DATE 20 5	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
5/13/14	2940.7	ETT	2940.7	SMOH 582 changed oil w/ 8 qts shell 15-50, changed oil screen, drained carb, changed gaps plugs, CK mag's, Comp CK 1) 74 2) 74 3) 77 4) 75 5) 75 6) 75. 5/13/14 <i>[Signature]</i> for BGR558C.
BERKSHIRE AVIATION ENT. INC. GREAT BARRINGTON AIRPORT GREAT BARRINGTON, MASS. 01230 FAA APPROVED REPAIR STATION No. BPCR558C				I certify that this aircraft has been inspected in accordance with a <i>Annual</i> inspection and found to be airworthy Berkshire Aviation Ent. Inc. FAA approved repair station No. BPCR558C Repair order on file No. <i>6460</i>
				<i>[Signature]</i> 5/13/14 Signed Date
5-14-14	2941.0	.3		GBR to PSF.
6-2-14	2941.4	.4		PSF to AQW.
6-2-14	2941.7	.3		AQW to PSF.
6-10-14	2942.2	.5		PSF
6-17-14	2942.6	.4		PSF Density Altitude 2,900 feet
9-9-14	2943.3	.7		PSF To Jimmy Peak, Robert's house, and home.